Terminator[™] ECM-MI-WP Electronic Control Module INSTALLATION PROCEDURES

For Use with MI Mineral Insulated Heating Cable Sets





Terminator[™] ECM-MI-WP

INSTALLATION PROCEDURES

The following installation procedures are suggested guidelines for the installation of the Terminator ECM-MI-WP Kit.

Receiving, Storing and Handling ...

- 1. Inspect materials for damage incurred during shipping.
- 2. Report damages to the carrier for settlement.
- 3. Identify parts against the packing list to ensure the proper type and quantity has been received.
- 4. Store in a dry location.

Kit Contents . . .



Wire Pins (per MI cable cold lead, order separately)

ltem	Quantity	Description
1	1	Expediter Assembly Support Cap with O-Ring Threaded Grommet Compressor Grommet Support Base with O-Ring
2	1	Junction Box Lid
3	1	Junction Box Base, O-Ring, M25 Dust Cap, earth plates and ground wires
4	1	Nut
5	1	Banding
6	1	Electronic Control Module w/ Terminal Blocks (Refer to terminal specifications for maximum allowable wire size) ECM Type C - Controller L - Limiter CL - Controller/Limiter
7	1	Junction Box Lid Cord
8	4	Blind Plug & Lock Nut
9	1	Bracket
10	3	Screws
11	3	Washers
12	2	Wire Pins

Order Separately ...

IEK Insulation Entry Kit (per cable)

IEK-PTD

For PTD lead wire

Dimensions . . .



Warnings . . .

- Due to the risk of electrical shock, arcing and fire caused by product damage or improper usage, installation or maintenance, a ground-fault protection device is required.
- Installation must comply with Thermon requirements (including form PN 50273U for Ex systems) and be installed in accordance with the regulations as per the norm EN IEC 60079-14 for hazardous areas (where applicable), or any other applicable national and local codes.
- · Component approvals and performance ratings are based on the use of Thermon specified parts only.
- · De-energize all power sources before opening enclosure.
- · Avoid electrostatic charge. Clean only with a damp cloth.
- Keep ends of heating cable and kit components dry before and during installation.
- Minimum bending radius of heating cable is six (6) times the cable outer diameter.
- · Individuals installing these products are responsible for complying with all applicable safety and health guidelines. Proper Personal Protective Equipment (PPE) should be utilized during installation. Contact TC-E if you have any additional questions.

Tools Required



Certifications/Approvals ...

IP66 -60°C ≤ Ta ≤ +50°C T5, 100°C; -60°C ≤ Ta ≤ +40°C T6, 85°C Ordinary & Hazardous Locations



International Electrotechnical Commission IEC Certification Scheme for Explosive Atmospheres SIR 12.0103X



C € ⟨E⟩ III 2 (2) G Ex eb mb [ib] IIC T4, Ex tb IIIC T135°C SIRA 12ATEX5239X II 2 (2) D Ex tb IIIC T135°C IP66 Db

PTD100 Temperature Sensor



Terminator[™] ECM-MI-WP INSTALLATION PROCEDURES



1a. Mounting Method 1: Secure wall mount bracket to mounting surface using pipe band.



1b. Mounting Method 2: Secure wall mount bracket to mounting surface using screws, washers, and nuts (customer provided)



2. Mount expediter to bracket using M5 screws and lock washers.



3. Crimp appropriate wire pins (2.5 mm² or 6 mm²) on MI cable cold lead wires.



4. Route MI cable and PTD100 cold leads through M20 threaded entries. Screw cable glands into junction box.

CAUTION Do not overtighten to ensure o-ring is not damaged during installation.



5. Center cold lead sleeve inside cable gland. Tighten cable glands until ferrule begins to make contact with cold lead sleeve and cold lead sleeve cannot be moved by hand. Tighten cable gland 1/8 additional turn or to a torque value of 16 Nm (142 lb-in).



 Install M20 blind plug in remaining M20 threaded entry (if necessary). Additional M20 blind plug (order M20-B-EXE) will be required if only installing one gland. Tighten existing blind plugs.



7. Remove M25 dust cap. Install M25 power gland (customer supplied) in M25 threaded entry.



 Mount junction box base on expediter. Make sure to align slots to properly orient junction box base. Tighten nut with Terminator-LN-Tool. If mounting horizontally, threaded gland holes must face downward.



The Heat Tracing Specialists®

Terminator[™] ECM-MI-WP INSTALLATION PROCEDURES



9. Install power cable (if necessary).



10. Install electronic control module and complete system wiring. Terminal set screws shall be tightened to a torque value of 1,4 Nm (12,4 lb-in). See wiring details. Set modules electronic control and/or control limiter at desired setpoints.



11. Use the rotary switches for settling Control and Limit Temperature, (Celsius or Fahrenheit) and Auto or Manual reset (Control switches on Type "C", Limiter switches on Type "L" and both on Type "CL").



12. Install junction box lid and twist hand tight. Insert screwdriver into ratchet slots located on side of junction box base. Use screwdriver to ratchet on junction box lid. Lid will rotate 30 degrees. To remove lid, repeat steps in the opposite direction.



13. Fix PTD100 to pipe. Seal penetration through insulation cladding.

Comm. Port	Alarm Relay
RTD Limiter Sensor	B B A Controller Sensor

Wiring Details



THERMON . . . The Heat Tracing Specialists®

TC-E B.V. Buitendijks 37 3356 LX Papendrecht • The Netherlands Phone: +31 (0) 183-20 10 88 Specifications and information are subject to change without notice. Form PN50870U-0113

ISO 9001