

Terminator ZP/FAK-4LHT

In-Line Splice Kit for Electrically
Heated TubeTrace® Bundles

INSTALLATION PROCEDURES



Terminator ZP/FAK-4LHT

The following installation procedures are suggested guidelines for the installation of the Terminator ZP/FAK-4LHT In-Line Splice Kit.

Receiving, Storing and Handling


1. Inspect materials for damage incurred during shipping.
2. Report damages to the carrier for settlement.
3. Identify parts against the packing list to ensure the proper type and quantity has been received.
4. Store in a dry location.

Terminator ZP/FAK-4LHT Kit Contents



Item	Quantity	Description
1	1	Expediter Assembly: Flat Mount Base, Grommet, Threaded Grommet Compressor, and Support Cap with O-Ring
2	1	Junction Box Lid
3	1	Junction Box Base with O-Ring
4	1	Nut
5	1	Terminal Blocks with DIN Rail (Refer to terminal specifications for maximum allowable wire size)
6	1	Junction Box Cord
7	1	In-Line Splice Cover (Top)
8	1	In-Line Splice Cover (Bottom)
9	1	Heat Reflective Tape
10	3	RTV Sealant Tube
11	1	Glass Fiber Tape
12	1	Silicone Gasket
13	1	Self-Vulcanizing Tape
14	1	Fiberglass Rope, 13 mm x 366 cm (1/2" x 12')
15	1	Heavy Foil Tape, 44.5 mm (1.75") wide

Dimensions

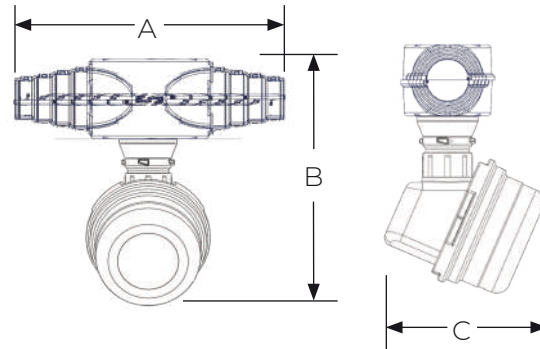

	A mm (inch)	B mm (inch)	C mm (inch)
Terminator ZP/ FAK-4LHT	489 mm (19-1/4")	305 mm (12")	185 mm (7")

Required: Order Separately for each heater to be fabricated. PETK Power and End Termination Kits (one req'd. per heater)

PETK-3 for HPT

Tools Required



Terminator ZP Certifications/Approvals



European Organisation for Electrotechnical Standardisation
Hazardous (Classified) Locations



II 2 GD Ex eb IIC T4-T6, Ex tb IIIC T135°C-T85°C FM 10ATEX0058X



FMG 10.0022X Ex eb IIC T4-T6, Ex tb IIIC T135°C-T85°C



FM Approvals
Hazardous (Classified) Locations



Underwriters Laboratories Inc.
Hazardous (Classified) Locations

Terminator has additional hazardous area approvals including:


- GGTN · Kazakhstan

INSTALLATION PROCEDURES

The Terminator ZP/FAK-4LHT In-Line Splice Kit is designed to make a waterproof seal over the end of TubeTrace at the splice connections. Review instructions prior to installation. Kit will make one splice connection (Tube fittings not included). See separate instructions for details on splicing heat tracing.


Installation Precautions

- To minimize the potential for arcing on electrical heat tracing and fire caused by product damage or improper installation, use ground-fault protection. The National Electrical Code (NEC) and Canadian Electrical Code (CEC) require ground-fault protection of equipment for each branch circuit supplying electrical heat tracing.
 - Installation must comply with Thermon requirements and be installed in accordance with the NEC, CEC, or any other applicable national and local codes.
 - Component approvals and performance ratings are based on the use of Thermon specified parts only.
- User supplied power connection fittings must be listed or certified for intended use.
- De-energize all power sources before opening enclosure.
 - Keep ends of heating cable and kit components dry before and during installation.
 - Individuals installing these products are responsible for complying with all applicable safety and health guidelines. Proper personal protective equipment, or PPE, should be utilized during installation. Contact Thermon if you have any additional questions.

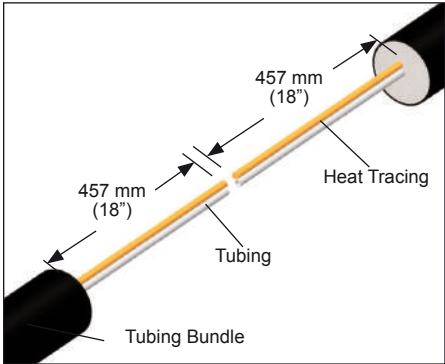


- Remove outer jacket and insulation from tubing bundle approximately 457 mm (18") from end of the tubing bundle.


CAUTION Do not cut or damage the heat trace or sampling tube. (Found on TubeTrace SE/ME bundles)

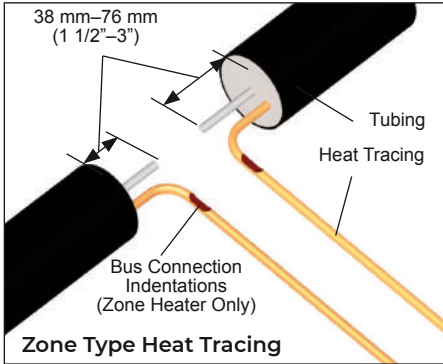


- Strip back bundle insulation 38 mm (1-1/2") to 76 mm (3") beyond bus connection indentation of each heat tracing. If bus connection indentation is less than 305 mm (12")-381 mm (15") from end of the heat tracing, proceed stripping the bundle insulation to the next indentation. Trim tubes so the bus connection indentation on each meet.

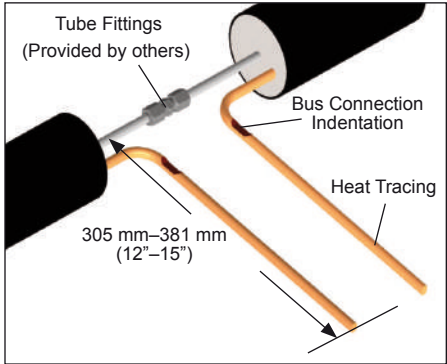


- Make tube connections with appropriate fittings, provided by others. Test fittings for leaks before proceeding.

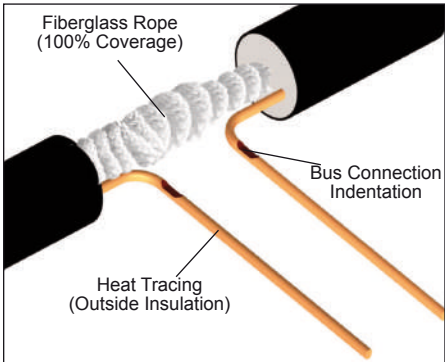

- Wrap high temperature tubing with 1/2" fiberglass rope. Ensure 100% coverage to keep tubing and heat tracing from making contact. **DO NOT wrap heat trace with fiberglass rope.**

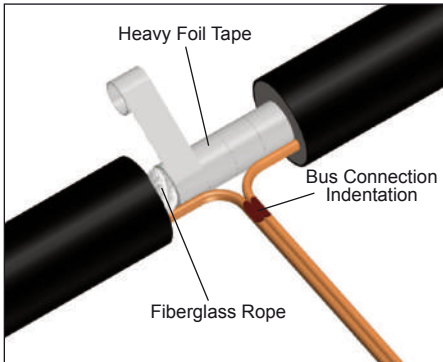


- Wrap rope with one pass of heavy foil tape (25% overlap).

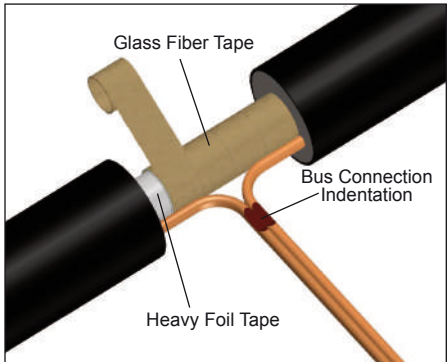


- Wrap with 3 passes of glass fiber tape (50% overlap).


Terminator ZP/FAK-4LHT

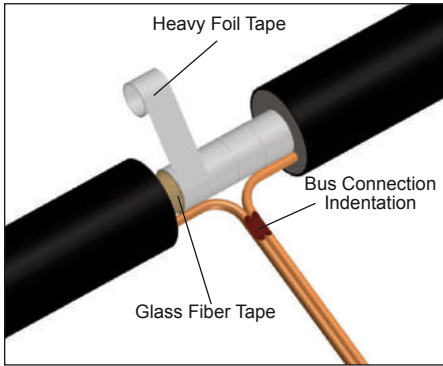


7. Add 1 additional pass of heavy foil tape (25% overlap).

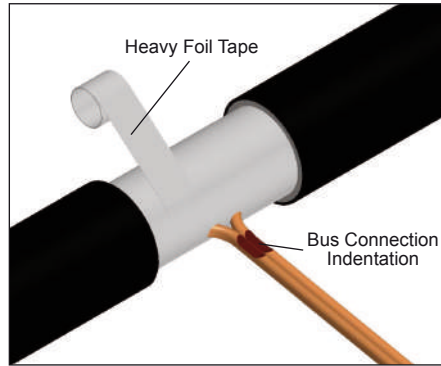


8. Complete with 1 additional pass of heavy foil tape (25% overlap) to cover heat trace.

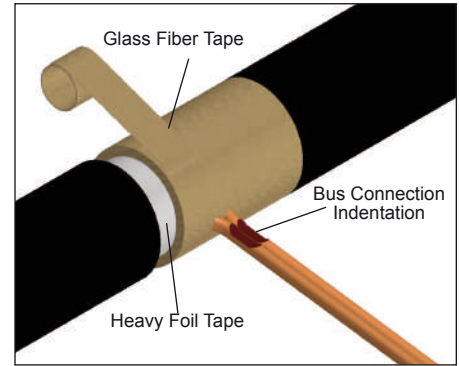


9. Wrap with 4 passes of glass fiber tape (50% overlap), or until fiber tape is equal to original bundle insulation thickness.

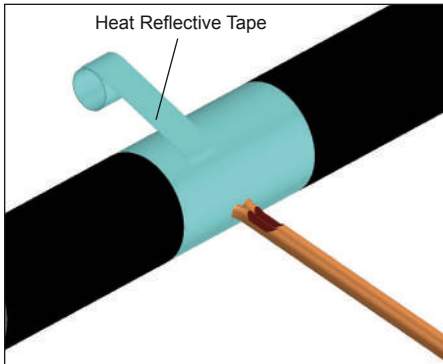


10. Wrap with 1 additional pass of heat reflective tape (50% overlap).

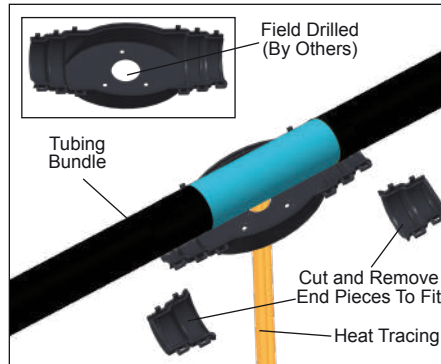


11. Cut splice cover ends to match outside diameter of tubing bundle. Field drill expediter base holes.

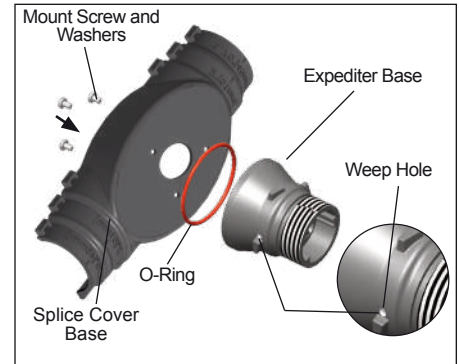

12. Mount expediter base with o-ring to the splice cover base using (3) M5 mounting screws and lock washers. Punch out weep hole.

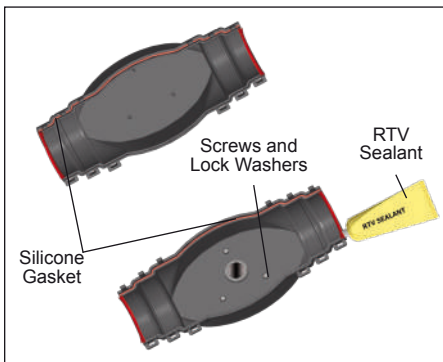

13. Install silicone gasket and cut off excess. Apply RTV sealant to both halves.

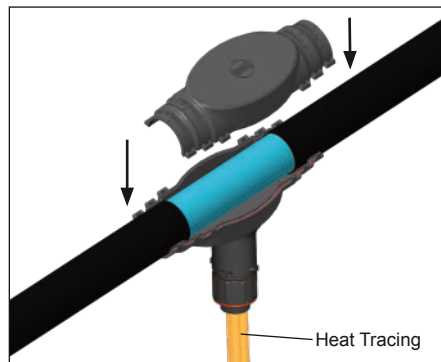


14. Assemble splice cover top, tubing bundle, and splice cover base together as shown. Snap together firmly. Inspect ends of tubing splice cover for snug fit. Apply additional RTV sealant where needed.




15. Apply self-vulcanizing tape around bundle jacket and work up over FAK ends.

INSTALLATION PROCEDURES

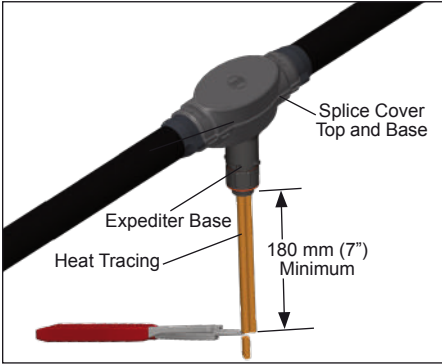


16. Trim heat tracing to 180 mm (7") minimum from expediter base.

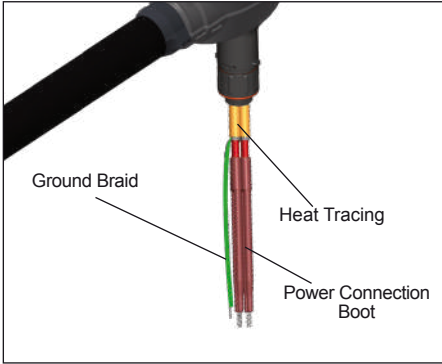


17. Terminate heat tracing with appropriate PETK termination kit. Refer to PETK installation instructions (purchase separately) for details not addressed here.




18. Mount junction box on expediter making sure to align slots to properly orient junction box base.

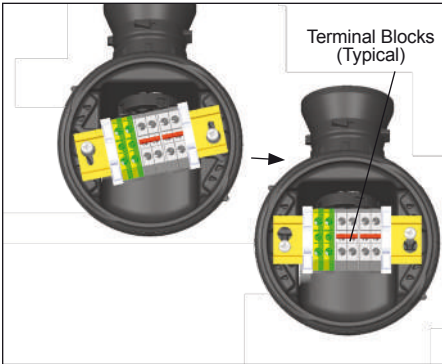

19. Install quick mount terminal blocks twist to position and tighten screws.

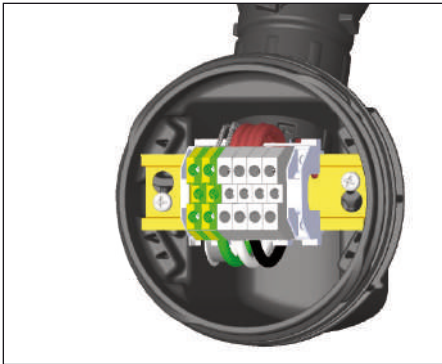

20. Complete system wiring per wiring diagram.

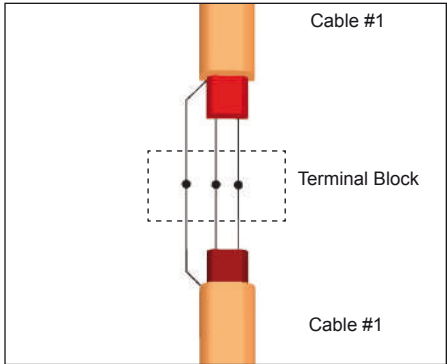

Complete system wiring diagram.



21. Install junction box lid and twist hand tight. Insert screwdriver into ratchet slot located on side of junction box base to tighten. Lid will rotate 30°.



22. Lid latch mechanism fully engaged. To remove lid, repeat step 21 but in opposite direction.



23. Completed Terminator ZP/FAK-4LHT assembly for TubeTrace Type SE/ME Bundle.

